## MARION COUNTY SURVEYOR'S OFFICE

DEBRA S. JENKINS MARION COUNTY SURVEYOR SECTION CORNER RECORD SEC.  $34\,\mathrm{TWN}$ .  $16_{\scriptscriptstyle N}$  RNG.  $4_{\scriptscriptstyle E}$ 

BRYAN F. CATLIN, PLS TECHNICAL SUPERVISOR

Date: 5-18-09

Party Chief: Wilcoxen


Crew: Finney


Type of Marker: Harrison set

Method of Establishment: County: 4-28-93

IN S.P.C. E Zone, NAD 83

Name: 16043402 N: 504 975.985 0(m) E: 65 126.383 0(m)

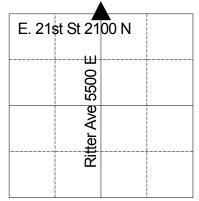

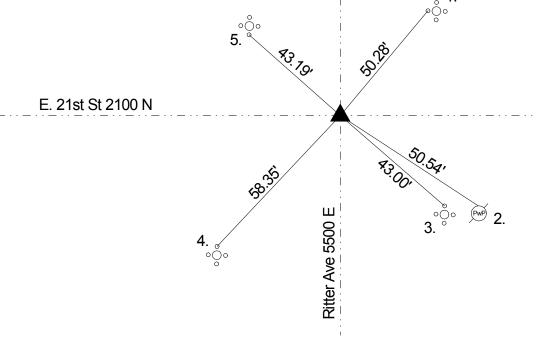

Corner originally set as a post in 1820 by John Hendricks with the following witnesses: 16" beech bearing S 84 E 32 links and a 24" dogwood bearing S 71 W 17 links. ( M. C. Atlas p. 11) A survey by H. B. Fatout on April 7th,1852 indicates no stone but the following witnesses: 8" walnut bearing N 64.50 W 68 links and a 10" apple bearing N 39.50 E 44 links ( Warren Legal Book p. 7). Corner referenced by Monroe on 6/29/1951 and called a square bolt. Corner referenced by Hankins on 6/24/58 and called a PK nail. Corner referenced by MCS on 8/26/64 and called a PK nail. Corner referenced by McLand on 6/29/73 and called a RR spike. Corner referenced by Wilcoxen on 2/3/76 and called a RR spike. Corner excavated on 4/28/93 and called a square bolt. Corner referenced by Kiste on 7/7/1999 and called a square bolt 3" down. Corner referenced by Wilcoxen on 10/12/2006 and called a square bolt 3" down. Corner excavated by Wilcoxen on 5/14/2009 and a square bolt was found 4" down in brick pavement. A stone was found 12" down (10"x12"x20"). A # 205 cast iron Harrison monument was set in position of the stone.

REF.	DISTANCE	DESCRIPTION
1.	50.28'	Cut 'x' W-bolt traffic signal base
2.	50.54'	PK nail N PwP #404-475 B 6" up
3.	43.00'	Cut 'x' N-bolt traffic signal base
4.	58.35'	Cut 'x' N-bolt traffic signal base
5.	43.19'	Cut 'x' S-bolt traffic signal base